



Must Remain On Site

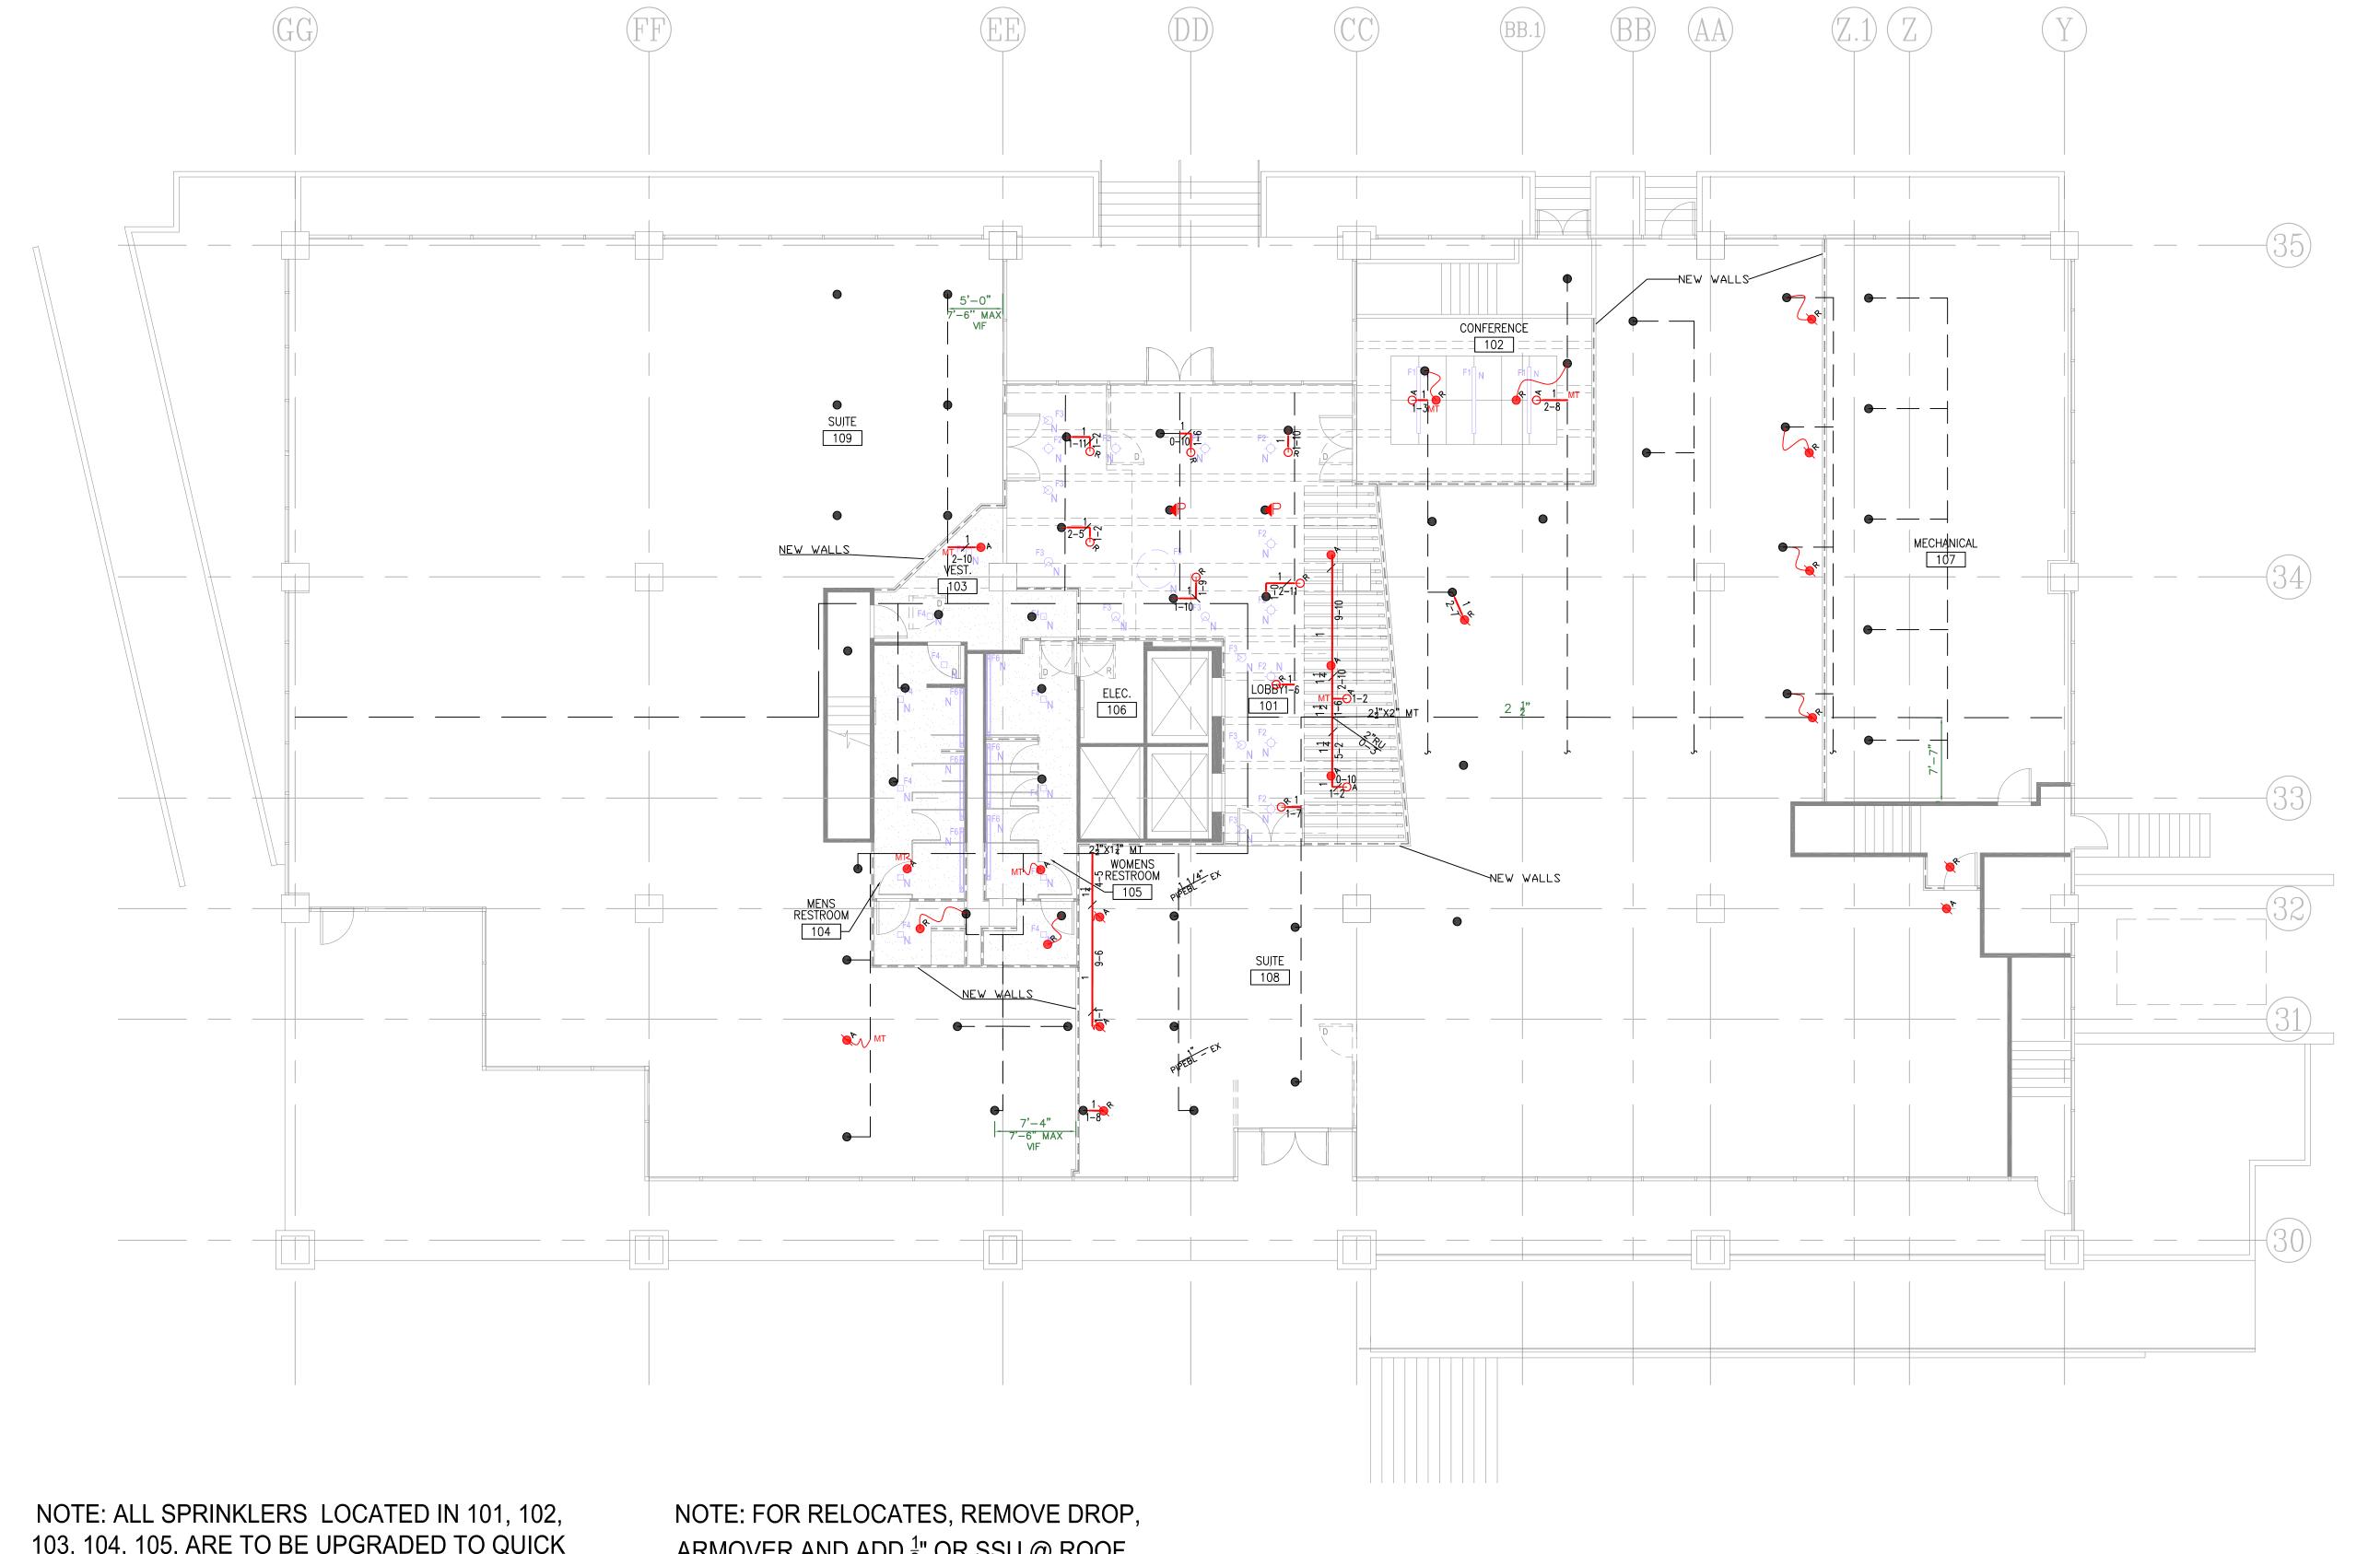


SPRINKLER DETAILS

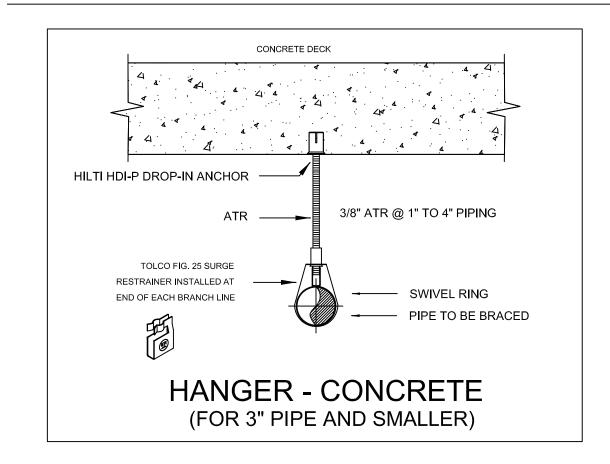

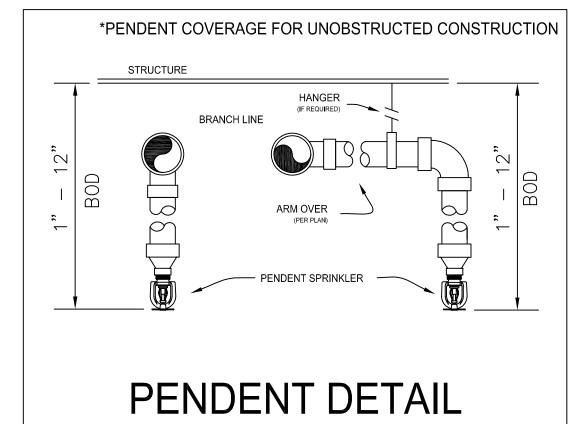

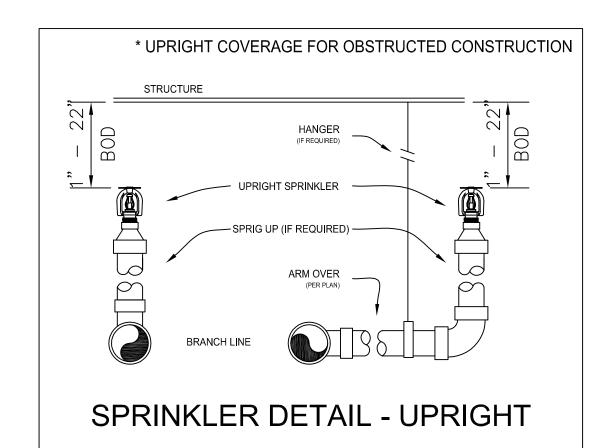

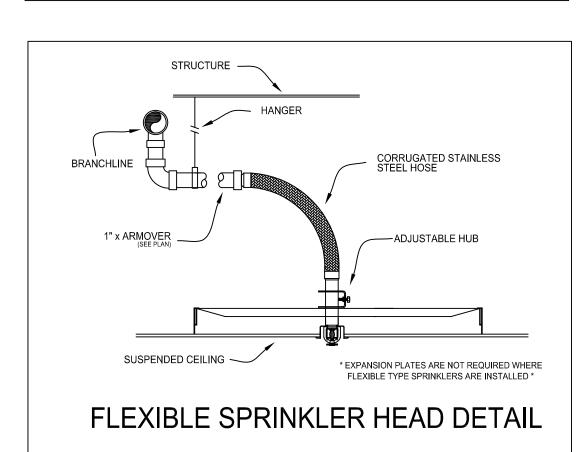


103, 104, 105, ARE TO BE UPGRADED TO QUICK RESPONSE, 155°F, 5.6K PENDENT AND UPRIGHT SPRINKLERS. (25 TOTAL)

ARMOVER AND ADD $\frac{1}{2}$ " QR SSU @ ROOF STRUCTURE. (TYP. IN OPEN STRUCTURE AREA)

FIRE SPRINKLER PLAN 1/8'' = 1'-0



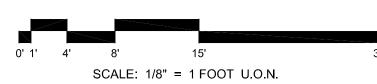


SPRINKLER KEY

- PENDENT SPRINKLER UPRIGHT SPRINKLER SPECIAL APPLICATION PENDENT SPRINKLER SPECIAL APPLICATION UPRIGHT SPRINKLER
- PENDENT AND UPRIGHT SPRINKLER CONCEALED SPRINKLER
- EXTENDED COVERAGE CONCEALED SPRINKLER EXTENDED COVERAGE PENDENT SPRINKLER SIDEWALL SPRINKLER
- DRY SIDEWALL SPRINKLER DRY PENDENT SPRINKLER
- DRY EXTENDED COV. PENDENT SPRINKLER RELOCATE SPRINKLER
- ADD SPRINKLER PLUG OUTLET
- SPRINKLER PIPE CAP SPRINKLER PIPE DROP SPRINKLER PIPE RISE
- EXISTING SPRINKLER PIPING ---- NEW SPRINKLER PIPING * SEE SPRINKLER LEGEND FOR SPECIFIC SPRINKLER TYPES *

GENERAL NOTES

- RESPONSIBILITY TO PROVIDE HEAT THROUGHOUT THE WET PIPE DELUGE AND OTHER TYPES OF VALVES CONTROLLING WATER SUPPLIES TO SPRINKLER SYSTEMS
- 5. FIRE PROTECTION CONTRACTOR SHALL NOT BE RESPONSIBLE FOR THE ABILITY OF THE STRUCTURE TO ADEQUATELY SUPPORT THE FIRE SPRINKLER SYSTEM. 6. ALL ELECTRICAL, PAINTING OF PIPE, FURRING, CUTTING OR PATCHING
- 7. NEW AND RELOCATED SPRINKLER HEADS ARE TO BE ON 1" DYNATHREAD OR SCHEDULE 40 ARM OVERS.
- 8. NEW MAINS AND NEW BRANCH LINES ARE TO MATCH EXISTING PIPE SIZING WHERE HYDRAULIC CALCULATIONS ARE NOT REQUIRED. 9. SPRINKLER HEADS HAVE BEEN ADDED AND RELOCATED TO ACCOMMODATE TENANT IMPROVEMENTS. AREAS OUTSIDE SCOPE OF
- WORK ARE TO REMAIN. 10. THE OWNER IS RESPONSIBLE FOR THE PERIODIC INSPECTION, TESTING, AND MAINTENANCE OF THESE FIRE SPRINKLER SYSTEMS IN ACCORDANCE WITH THE REQUIREMENTS OF NFPA 25 1995 EDITION. THIS WORK MUST BE DONE BY QUALIFIED PERSONNEL STARTING AFTER THE WARRANTY PERIOD HAS EXPIRED. THE COMPANY THAT DESIGNED AND INSTALLED THIS SYSTEM IS THE BEST QUALIFIED TO PROVIDE THE ONGOING LONG TERM TESTING, SERVICING, AND MAINTENANCE OF THIS SYSTEM(S).

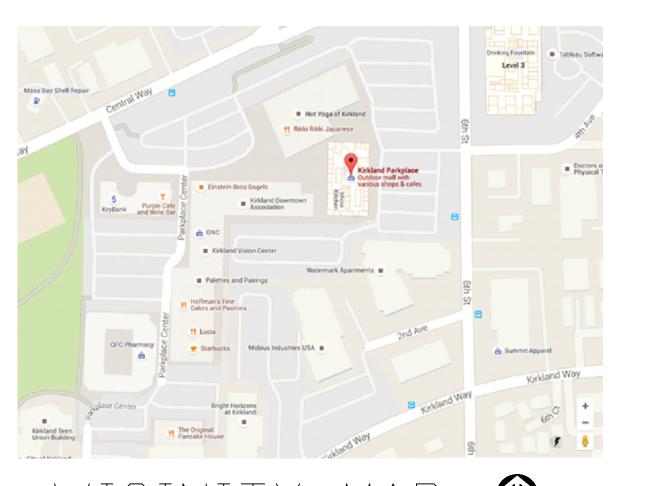

SCOPE OF WORK

- 1. ADD UPRIGHT AND PENDENT SPRINKLERS FOR THE NEW LOBBY DESIGN AND RELOCATE EXISTING HEADS IN ORDER TO
- ACCOMMODATE TENANT IMPROVEMENTS. 2. NEW SPRINKLERS IN THE LOBBY, RESTROOMS, AND CONFERENCE
- ROOMS ARE TO BE QUICK RESPONSE; OTHER LOCATIONS, MATCH HEAD TO EXISTING STANDARD RESPONSE HEADS.
- 3. ALL AREAS OUTSIDE SCOPE OF WORK ARE TO REMAIN AS IS AND UNAFFECTED BY TENANT IMPROVEMENT.

SPRINKLER LEGEND

OI KIINKEEK EEGEND												
	SYM	TYPE	COLOR	ESC	RESPONSE	TEMP	K	NPT	MFG.	MODEL#	ID#	QTY
	● A	SSP	BRASS	WHITE	QR	155	56	1/2"	TYCO	TY-FRB	TY3231	e
	OA	SSU	BRASS	WHITE	QR	155	5.6	1/2"	TYCO	TY-FRB	TY3131	4
	○ ?	SSU	BRASS	WHITE	QR	155	5.6	1/2"	TYCO	TY-FRB	TY3131	8
	● ₹	SSP	BRONZE	WHITE	STANDARD	155	5.6	1/2"	AUTOMATIC	Н	38-7020H	4
		SSP	BRONZE	WHITE	STANDARD	155	5.6	1/2"	AUTOMATIC	Н	38-7020H	36
		SSP	BRONZE	WHITE	STANDARD	155	5.6	1/2"	TYCO	TY-B	TY3251	4
	○ ?-	SSP	BRONZE	WHITE	STANDARD	155	5.6	1/2"	TYCO	TY-B	TY3251	7
♦ P PLUGGED HEADS		2						TOTAL	TOTAL AFFECTED			



SEATTLE: 5005 3RD AVE SOUTH SEATTLE, WA. 98134 (206) 762 - 3311

16790 NE MASON STREET, SUITE 100 PORTLAND, OR 97230

(503) 331 - 0234

PORTLAND:

PROJECT:

Kirkland Parkplace Marketing Suite First Floor

401 Parkplace Kirkland, WA 98033

REGISTRATION:



REVISIONS:							
1	6/23/15	FP ISSUE FOR PERMIT					
	-						
	-						
	-	-					
NO.	DATE	DESCRIPTION					

McKINSTRY DIVISION:

FIRE PROTECTION

DESIGNED BY: CHECKED BY: SS JOB NUMBER: <u>102930-001</u>

SHEET TITLE:

KPP LOBBY DESIGN







SHEET NUMBER:

FP-L01-TI